2015 INTERNATIONAL 5900i | 3HTMJAPT4FN739620



Specifications

ISX Miles	217437	Engine Hours	13079
Engine Make	Cummins	Engine Model	ISX15 455 V
Engine Serial	79793815	Engine HP	455
Fuel Type	Diesel	Fuel Tanks	2 Alum
Fuel Capacity	200	Exhaust	Single
Breathers	Single	Trans Make	Eaton
Trans Type	Manual	Trans Model	FRO-1621XC
Trans Speed	10	Cruise Control	Yes
Wet Line	Yes	Rear Make	Rockwell
Rear Ratio	4.10	Axle Type	Tandem
Axle F Capacity	20,000	Axle R Capacity	46,000
GVWR	66,000	Frame Type	Steel
Suspension	Air Axle	Wheelbase	264
Brake Type	Air	Engine Brake	Yes
Air Cond	Yes	Interior Color	Tan
Ext Paint Color	White	Sleeper Size	Mid
Power Mirrors	No	High Back Seats	Driver Side Only
Passenger Seat	Stationary	APU	No
Bumper	Chrome	Collision Avoidance	No

Tires, Wheels & Brakes - Front Axle

Left	Right
Tires/Wheels Fair ADVANCE 0.5 Wheels Aluminum Brakes Cracked	Tires/Wheels Fair ADVANCE 0.5 Wheels Aluminum Brakes Cracked

Tires, Wheels & Brakes - Rear Axles

Left Outer	Left Inner	Right Inner	Right Outer
Tires/Wheels Good 110.0.5 Wheels Aluminum Brakes Cracked	Tires/Wheels Good 110.0.5 Wheels Aluminum Brakes Cracked	Tires/Wheels Good 110.0.5 Wheels Aluminum Brakes Cracked	Tires/Wheels Good 110.0.5 Wheels Aluminum Brakes Cracked
Left Outer	Left Inner	Right Inner	Right Outer
Tires/Wheels Good 110.0.5 Wheels Aluminum Brakes Cracked	Tires/Wheels Good 110.0.5 Wheels Aluminum Brakes Cracked	Tires/Wheels Good 110.0.5 Wheels Aluminum Brakes Cracked	Tires/Wheels Good 110.0.5 Wheels Aluminum Brakes Cracked

Observations

Keys Present?	1 Sets	Oil Leaks?	No
Oil Milky?	No	Water Leaks?	No
Oil in Coolant?	No	Clutch Play?	No
Starts?	Yes	Cracked/Chipped Glass?	Yes
Lights Works?	Yes	Wipers Works?	Yes
Gauges Works?	Yes	Air Horn Works?	Yes
City Horn Works?	Yes	Active Fault Codes	Yes


General Observation Notes

24'x102" flatbed unit, steel frame with wood floor. Scan tool would not connect.

Deficiencies

Issue #	Check	Comment	Photo
1	Air wasn't build	Dryer blowing	
2	Windshield	Vertical and horizontal cracks on passenger side	
3	Exterior	Front bumper has been damaged on both ends	
4	Exterior	Deep scratches through paint and cracking around passenger headlight	
5	Exterior	Cracking, deep scratches and damp repair work around drivers headlight	
6	Exterior	Passenger mirror bracket missing hardware	
7	Mechanical	Front drive axle diff shows seepage	
8	Mechanical	PTO appears to be wet with seepage	
9	CDL	ABS, Fuel and Engine lights are on	

Photos

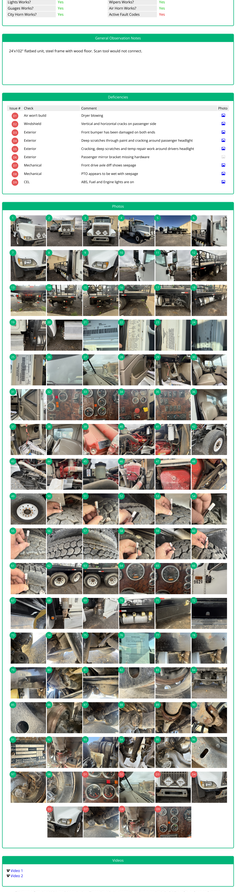

Videos

- Video 1
- Video 2

This report reflects the vehicle's condition at the time of inspection only. No warranty is made as to mechanical reliability, safety, or future performance.

© 2026 Beacon Inspection Services. All Rights Reserved
www.beaconinspection.com
(816) 631-9085