

2019 FREIGHTLINER M2 | 1FVACXFC4KHK56850



Specifications			
OD Miles	52462.7	ECM Miles	52431
Engine Hours	7887	Engine Make	Cummins
Engine Model	B6.7	Engine Serial	74408893
Engine HP	250	Fuel Type	Diesel
Fuel Tanks	1 Alum	Fuel Capacity	50
Exhaust	Horizontal	Breathers	Single
Trans Make	Allison	Trans Type	Auto
Trans Model	Unable to ID	Trans Speed	6
Cruise Control	No	Wet Line	Yes
Axle Type	Single	Axle F Capacity	13,300
Axle R Capacity	21,000	GVWR	33,000
Frame Type	Steel	Suspension	Spring
Wheelbase	252	Brake Type	Air
Engine Brake	No	Air Cond	Yes
Interior Color	Grey	Exterior Color	Red
Heated Mirrors	No	Fairings	None
Power Mirrors	No	High Back Seats	Driver Side Only
Passenger Seat	Stationary	APU	No
Bumper	Painted	Collision Avoidance	No


Tires, Wheels & Brakes - Front Axle	
Left	Right
<div>Tires/Wheels</div> <div>Fair</div> <div>11R22.5</div> <div>10/32</div> <div>Steel</div> <div>Brakes</div> <div>Covered</div>	<div>Tires/Wheels</div> <div>Fair</div> <div>11R22.5</div> <div>10/32</div> <div>Steel</div> <div>Brakes</div> <div>Covered</div>

Tires, Wheels & Brakes - Rear Axles			
Left Outer	Left Inner	Right Inner	Right Outer
<div>Tires/Wheels</div> <div>Fair</div> <div>11R22.5</div> <div>10/32</div> <div>Steel</div> <div>Brakes</div> <div>Covered</div>	<div>Tires/Wheels</div> <div>Fair</div> <div>11R22.5</div> <div>7/32</div> <div>Steel</div> <div>Brakes</div> <div>Covered</div>	<div>Tires/Wheels</div> <div>Fair</div> <div>11R22.5</div> <div>7/32</div> <div>Steel</div> <div>Brakes</div> <div>Covered</div>	<div>Tires/Wheels</div> <div>Fair</div> <div>11R22.5</div> <div>9/32</div> <div>Steel</div> <div>Brakes</div> <div>Covered</div>

Observations			
Keys Present?	1 Sets	Oil Leaks?	No
Oil Milky?	No	Water Leaks?	No
Oil in Coolant?	No	Clutch Play?	NA
Starts?	Yes	Cracked/Chipped Glass?	No
Lights Works?	Yes	Wipers Works?	Yes
Guages Works?	Yes	Air Horn Works?	NA
City Horn Works?	Yes	Active Fault Codes	No

General Observation Notes
6 speed transmission is not confirmed.

Deficiencies			
Issue #	Check	Comment	Photo
D1	Exterior	Surface Rust on Metal Components	
D2	Interior	Damaged Interior Seats	
D3	Tires	Uneven Tire Wear	
D4	Exterior	Scratched Exterior Paint	
D5	Exterior	Front Bumper Has Severe Rust	
D6	Exterior	Personal Decals On Driver/Passenger Door	
D7	Exterior	Driver/Passenger Steps Rusted	
D8	Interior	Aftermarket Cables	
D9	Underbody	Severe Rust On Undercarriage	

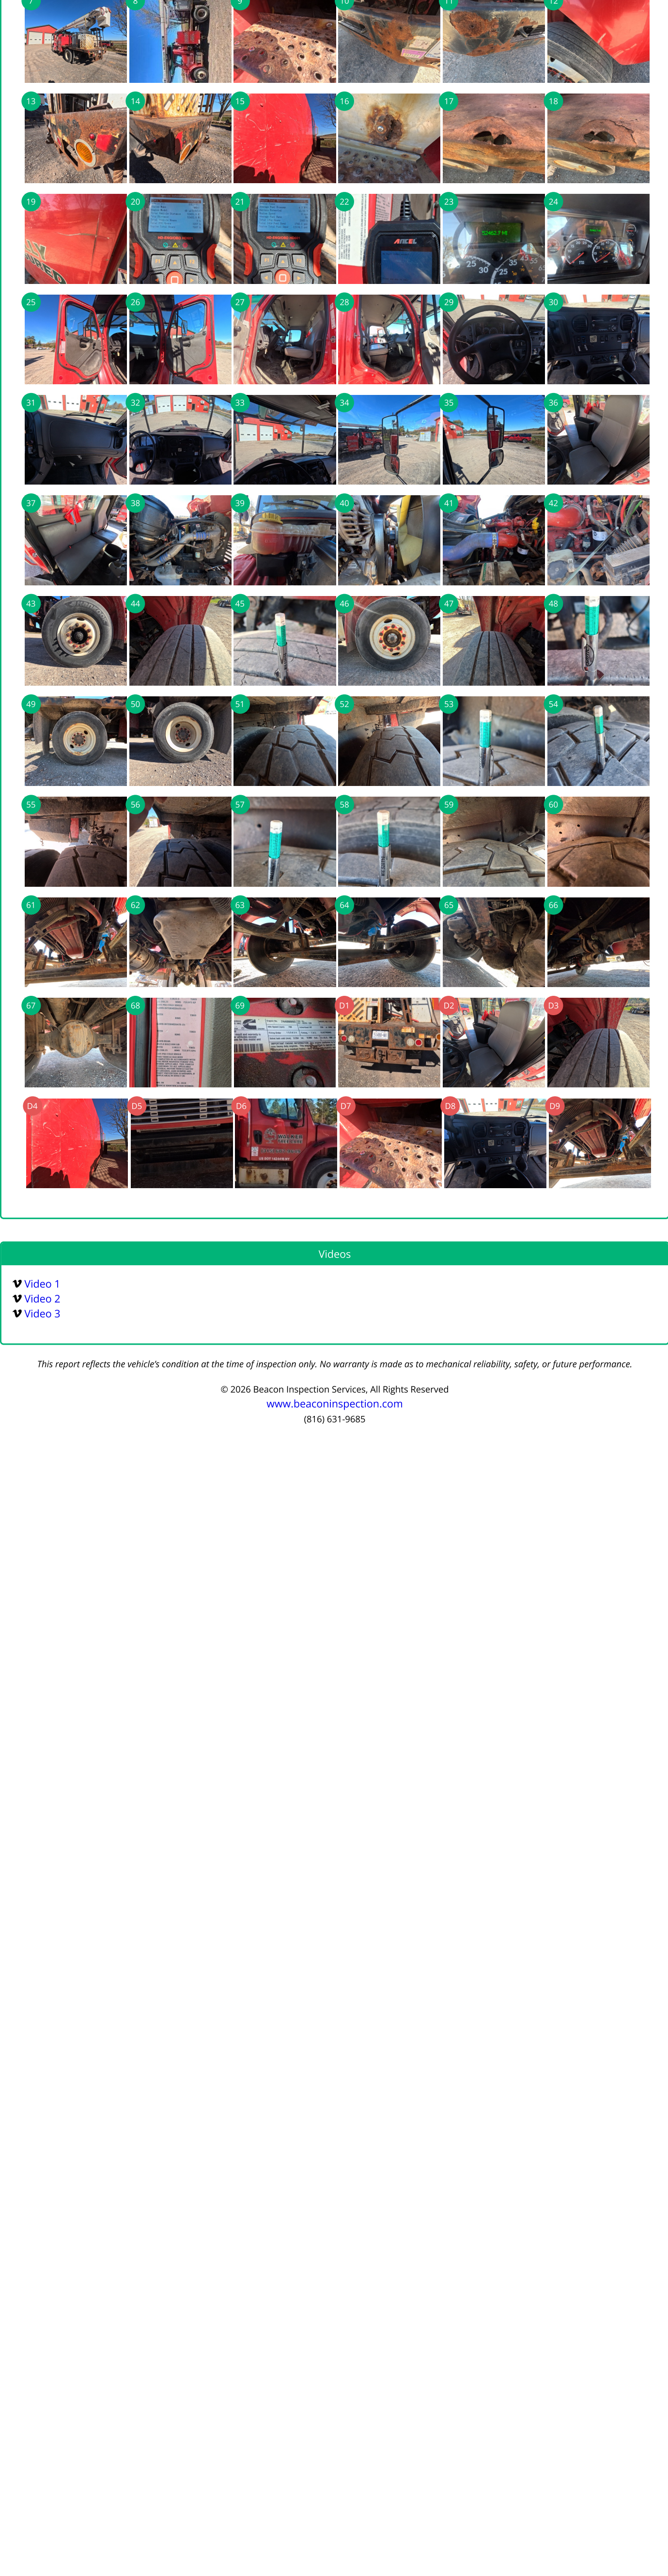

Videos
 Video 1
 Video 2
 Video 3