

2021 FREIGHTLINER M2 | 1FVACWFC4MHMN6711



Specifications			
OD Miles	50709.5	ECM Miles	50708.9
Engine Hours	5309	Engine Make	Cummins
Engine Model	B6.7	Fuel Type	Diesel
Fuel Tanks	1 Alum	Fuel Capacity	50
Exhaust	Horizontal	Breathers	Single
Trans Make	Allison	Trans Type	Auto
Trans Model	Unable to ID	Trans Speed	5
Cruise Control	No	Wet Line	No
Axle Type	Single	Axle F Capacity	12,000
Axle R Capacity	21,000	GVWR	26,000
Frame Type	Steel	Suspension	Spring
Wheelbase	197	Brake Type	Air
Engine Brake	No	Air Cond	Yes
Interior Color	Grey	Exterior Color	Red
Heated Mirrors	No	Fairings	None
Power Mirrors	No	High Back Seats	Driver Side Only
Passenger Seat	Stationary	APU	No
Bumper	Painted	Collision Avoidance	No

Tires, Wheels & Brakes - Front Axle			
Left		Right	
Tires/Wheels		Tires/Wheels	
Good		Fair	
11R22.5		11R22.5	
8/32		5/32	
Steel		Steel	
Brakes		Brakes	
Covered		Covered	


Tires, Wheels & Brakes - Rear Axles			
Left Outer		Right Outer	
Tires/Wheels		Tires/Wheels	
Good		Good	
11R22.5		11R22.5	
13/32		13/32	
Steel		Steel	
Brakes		Brakes	
Covered		Covered	

Left Inner		Right Inner	
Tires/Wheels		Tires/Wheels	
Good		Good	
11R22.5		11R22.5	
14/32		14/32	
Steel		Steel	
Brakes		Brakes	
Covered		Covered	

Observations			
Keys Present?	1 Sets	Oil Leaks?	No
Oil Milky?	No	Water Leaks?	No
Oil in Coolant?	No	Clutch Play?	NA
Starts?	Yes	Cracked/Chipped Glass?	No
Lights Works?	Yes	Wipers Works?	Yes
Guages Works?	Yes	Air Horn Works?	NA
City Horn Works?	Yes	Active Fault Codes	Yes

General Observation Notes	
5 speed transmission is not confirmed.	

Deficiencies			
Issue #	Check	Comment	Photo
D1	Exterior	Surface Corrosion Present on Metal Components	
D2	Exterior	Paint Cracking/Scraped	
D3	Exterior	Driver/Passenger Steps Rusted And Corroding	
D4	Interior	Interior Seat Upholstery Damaged	
D5	Underbody	Severe Rust On Undercarriage	
D6	Interior	Personal Decor On Headliner	
D7	Exterior	Personal Decals On Driver/Passenger Side	
D8	Fault Code	SPN 641 FMI 9 Variable Geometry Turbocharger (VGT) Actuator Fault	

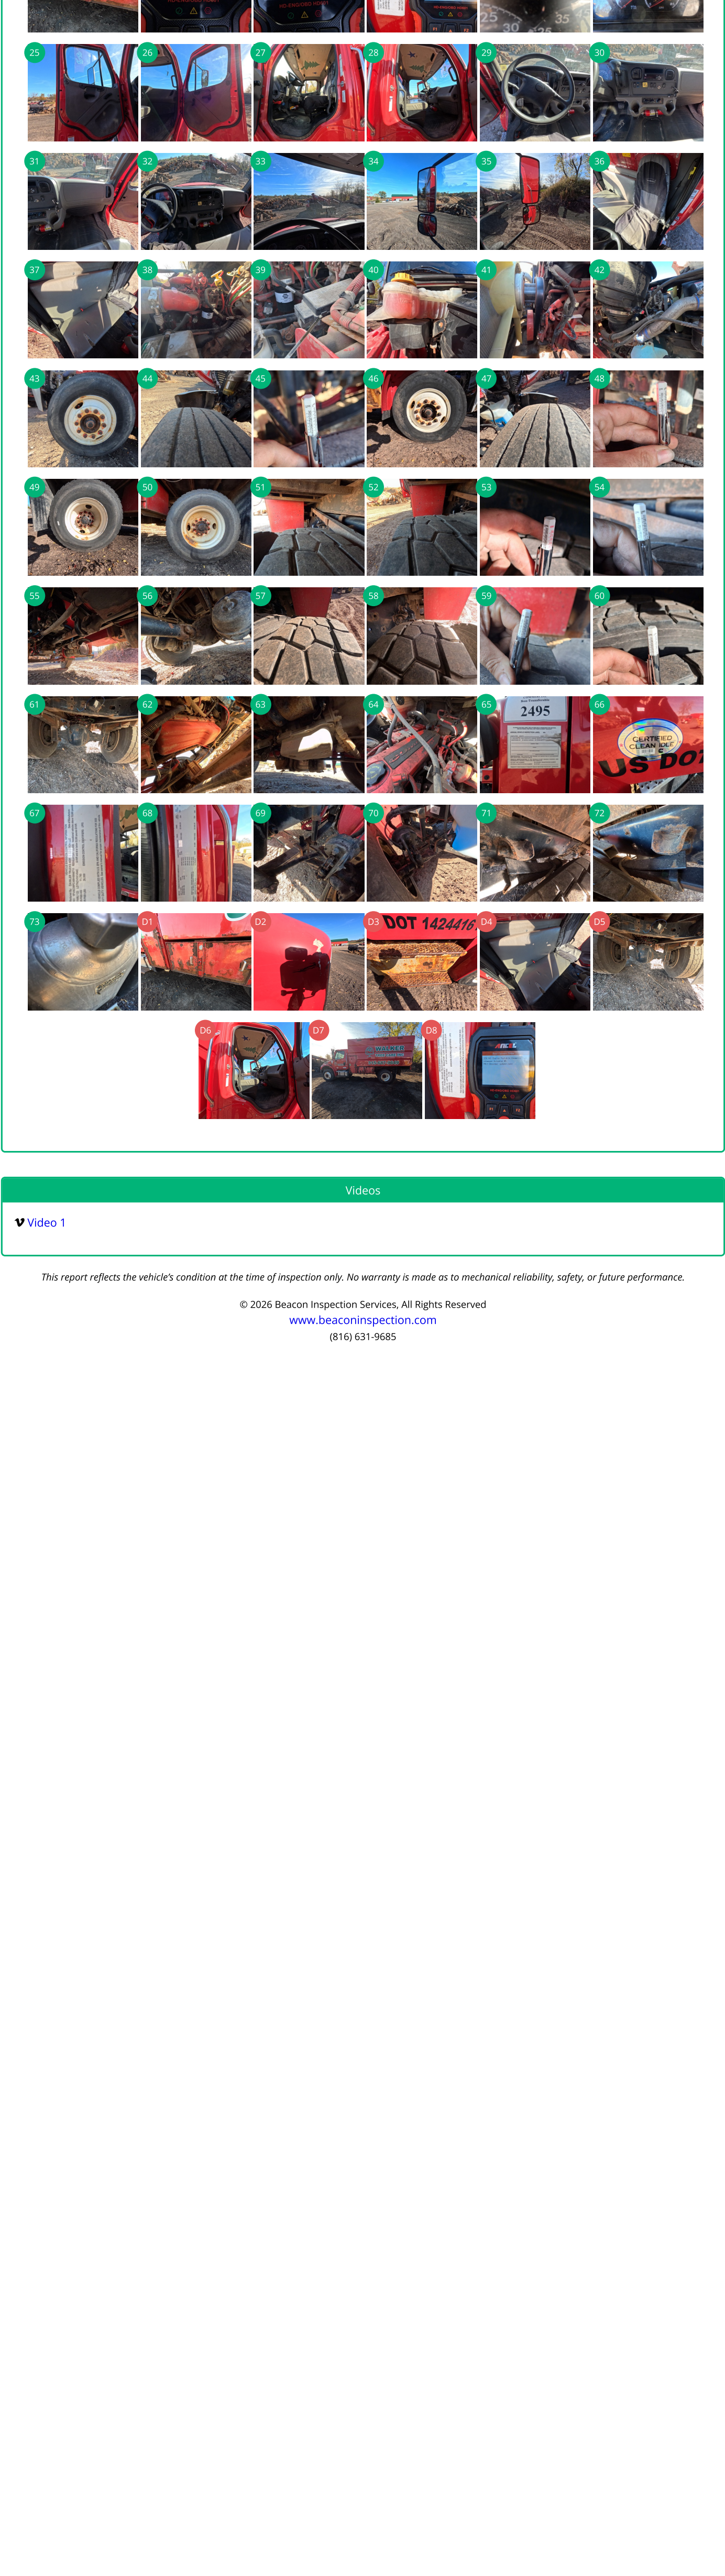

Videos	
 Video 1	